REPLICA-BASED CRACK INSPECTION

John A. Newman, Stephen W. Smith, and R.S. Piascik NASA Langley Research Center, Hampton, Virginia


Scott A. Willard Lockheed Martin Space Operations, Hampton Virginia

David S. Dawicke AS&M, Hampton, Virginia

INTRODUCTION

- Cracks found in Space Shuttle Main Engine LH₂ feedline flowliners (2002)
 - Ranged from 0.1 inch to 0.6 inch long
 - Weld repaired, polished, and recertified for flight
 - NDE: no cracks >0.075 inches long exist
- Revisited in 2004
 - Unable to show flight rationale with a crack 0.075 inches long


FLOWLINER DESCRIPTION

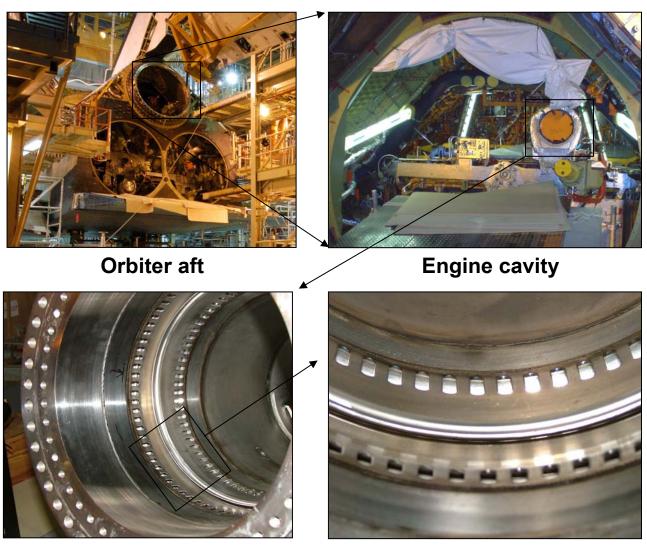


LH₂ feedline Flowliners

FLOWLINER DESCRIPTION

- LH₂ consumption
 - 385,000 gallons
 - 8.5 minutes
 - Each engine consumes 15,000 gal/min
 - Flow induced stress cycles in kHz range
 - Millions of stress cycles per flight

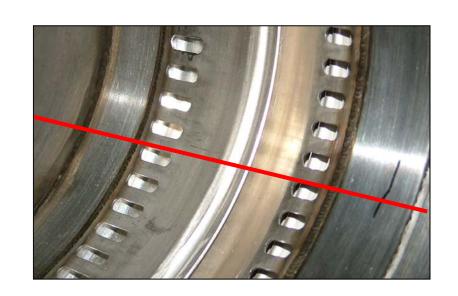

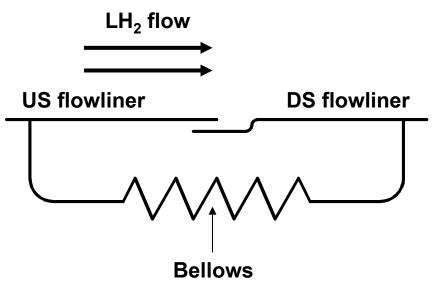

PROBLEM

- Analysis: unsafe conditions may occur for multiple cracks > 0.005 inch long
- Improved eddy current unable to detect 0.005-inch-long cracks
- Need an NDE method able to find cracks down to 0.005 inch long

PROPOSED SOLUTION

- Use surface replicas as an NDE method
- Surface replicas used for decades to monitor small cracks (<0.005 inch)
- Recently-developed silicone-based replicas better suited for inspection



Acetate tape replica



Silicone-based replica dispenser

EXPERIMENTAL PLAN


- Feasibility study:
 - Generate fatigue cracks in laboratory specimens
 - Compare crack lengths from
 - Silicone-based replicas (zero load)
 - Acetate-tape replicas (maximum load)
 - Destructive exam (zero load)
- Determine reliability of siliconebased replicas relative to acetate-tape replicas



FATIGUE TESTING


- Specimens used to simulate flowliner slot geometry and stress state
 - Pmax = 3.4 kips, R = 0.1
- Testing interrupted periodically for slot surface replication
 - Acetate-tape replicas
 - Silicone-based replicas



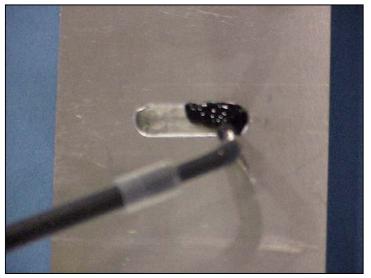


REPLICA ANALYSIS

- Replica preparation
 - Sectioned in 4 pieces
 - Grounded on metallic slide
 - Coated with metallic material
- Examined in an SEM
- Initial scan at 50-100X
 - Surface finish, scratches, etc.
- Crack scan at 400-700X

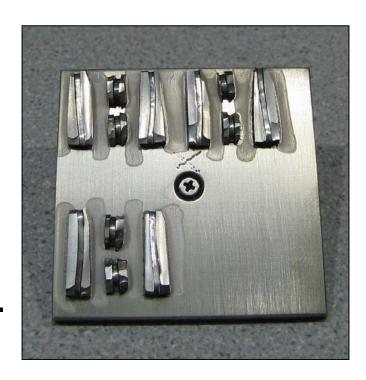


EXPERIMENTAL RESULTS


JEOL

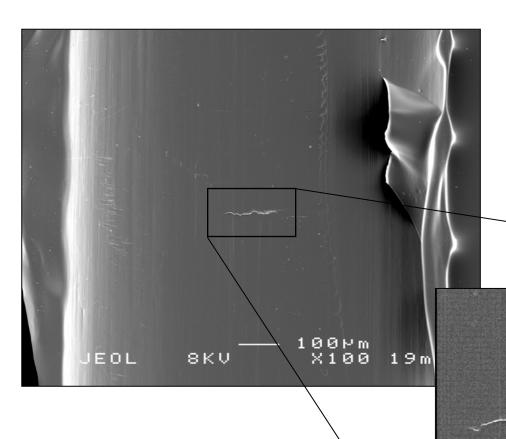


- Crack found after 50,000 cycles
 - Surface crack
 - 0.008 inches long

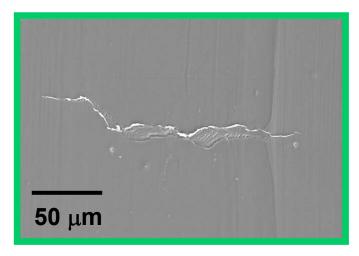

Acetate replica (loaded) – 163 μ m

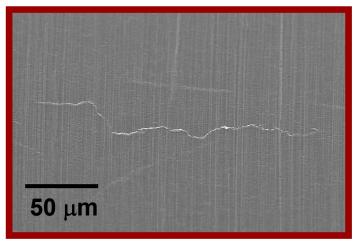


Silicone replica (no load) – 199 μ m

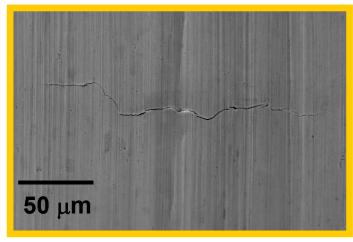


Specimen (no load) – 194 μm


EXPERIMENTAL RESULTS

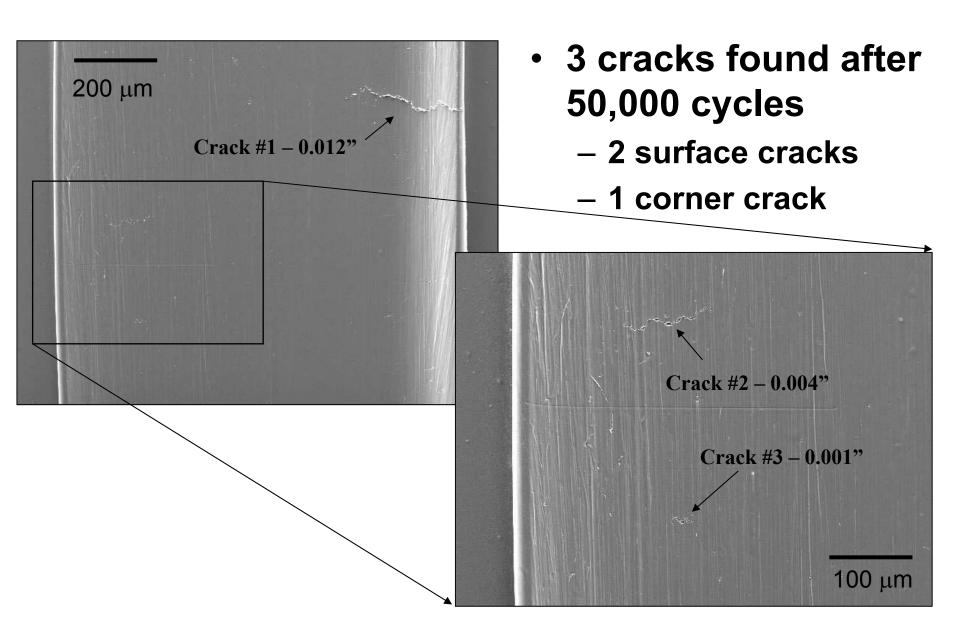


(Crack #1)

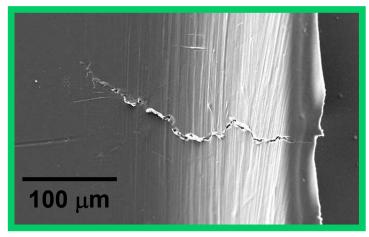

Acetate replica (loaded) - 280 μm

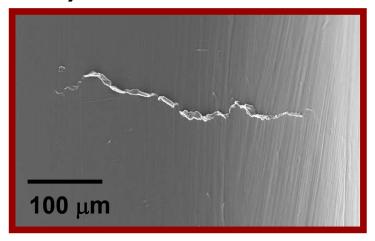


Silicone replica (no load) – 343 μ m

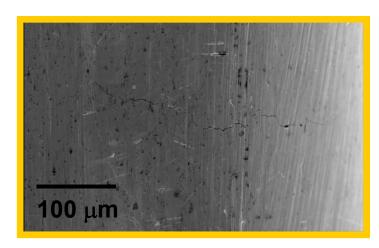


Specimen (no load) – 350 μm

(Crack #2)

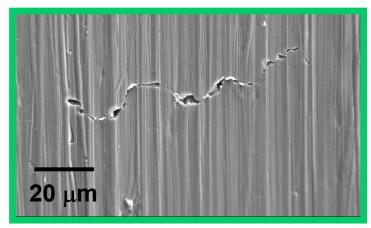

Acetate replica (loaded) - 81 μm

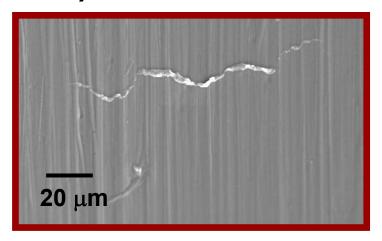


Silicone replica (no load) – 104 μ m




Specimen (no load) – 110 μm


(Crack #3)

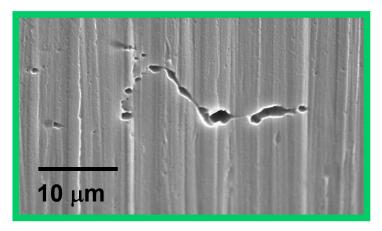

Acetate replica (loaded) - 20 μm

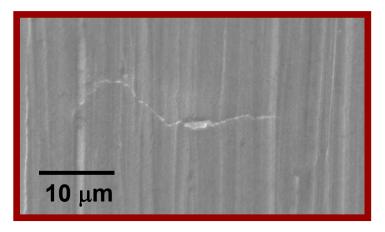

Silicone replica (no load) – 26 μ m

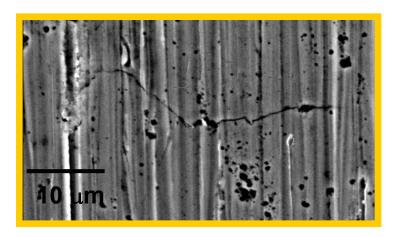


Specimen (no load) – 27 μm

CRACK DETECTION AFTER POLISHING


- Flowliner slots were polished after cracks detected in 2002
- One orbiter has not flown since flowliner slot polishing
- Concern about post-polishing crack detection
 - Crack mouth potentially filled with material

POLISHED CRACK DETECTION


Initial crack

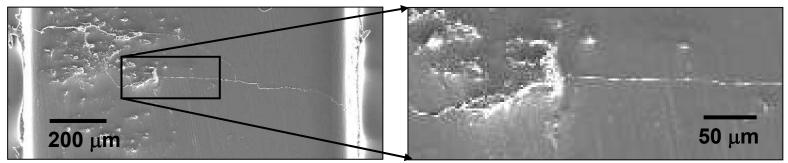

After polishing

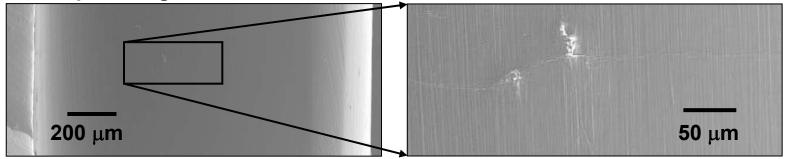


After polishing + 1 load cycle

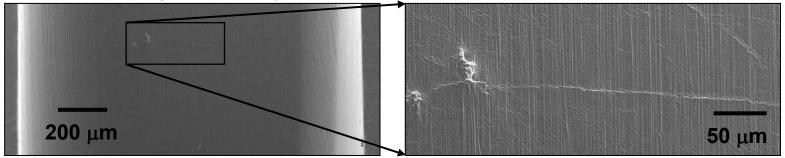


SURFACE FINISH QUALITY


- Pit-like damage from punching not completely removed by polishing
- At least 7 fatigue cracks initiated by 50,000 cycles
- Quality of surface finish is important

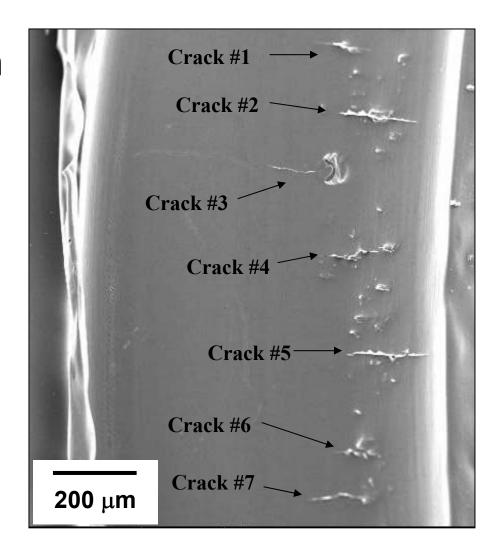


OTHER TYPES OF DAMAGE

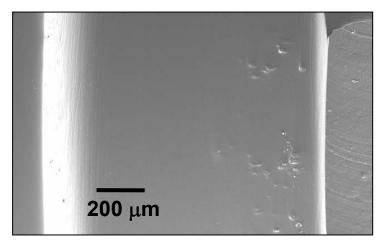


Pit damage

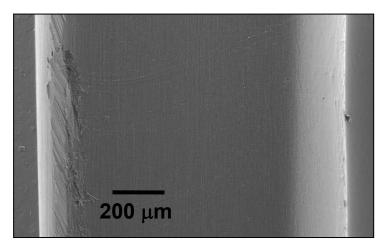

Abrasion and scratches

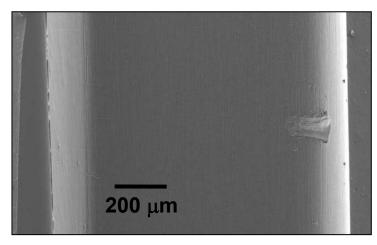


Tool mark

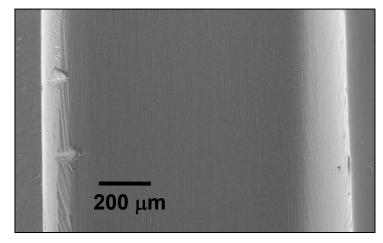


Tool marks/dents

REPRODUCIBILITY


- Concern: Repeated replication may fill crack mouth
- Repeated replicas taken on several cracked specimens
 - Example: 0.006-inch-long surface crack
- No degradation in crack detection

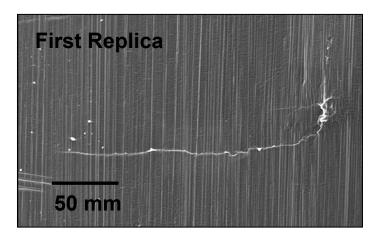

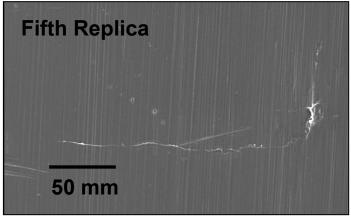

APPLICATION

- Replica-based inspection method approved for use on flight hardware
- Found 55 cracks in 3 orbiters
 - Ranging from 0.004 to 0.040 inches
- Confirmed repair by second round of replicas

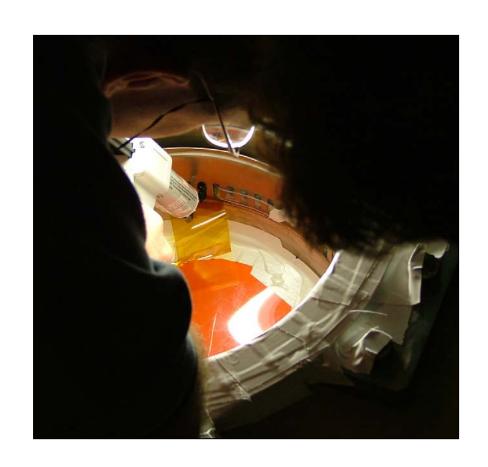

OTHER APPLICATIONS

- Replica-based crack inspection may be well-suited for other applications
 - Improved crack detection could make damage tolerance life management practical for additional components
 - Rotorcraft?
 - Propellers ?
 - HCF engine components?

PROS AND CONS

PROS

- Much better resolution than traditional NDE
- Little training required to make replicas
- Limited equipment needed in field

CONS

- More labor intensive than traditional NDE
- Limited to surface flaws
- Dependent on surface condition
- Limited to small areas
- No immediate feedback

SUMMARY

- Analysis of silicone-based replicas
 - Find cracks below 0.005 inches
 - Find pits/defects down to 0.001 inches
- Method approved for use on flight hardware
 - Found 55 cracks in 3 orbiters (684 slots)
 - Identified unacceptable levels of damage
 - Repair confirmed by second round of replicas